



## Microbial water quality in clean water tanks following inspection and cleaning

Christensen, Sarah Christine Boesgaard; Esbjørn, Anne; Albrechtsen, Hans-Jørgen

*Publication date:*  
2014

*Document Version*  
Publisher's PDF, also known as Version of record

[Link back to DTU Orbit](#)

*Citation (APA):*  
Christensen, S. C. B., Esbjørn, A., & Albrechtsen, H-J. (2014). *Microbial water quality in clean water tanks following inspection and cleaning*. Abstract from 9th Nordic Drinking Water Conference, Helsinki, Finland.

---

### General rights

Copyright and moral rights for the publications made accessible in the public portal are retained by the authors and/or other copyright owners and it is a condition of accessing publications that users recognise and abide by the legal requirements associated with these rights.

- Users may download and print one copy of any publication from the public portal for the purpose of private study or research.
- You may not further distribute the material or use it for any profit-making activity or commercial gain
- You may freely distribute the URL identifying the publication in the public portal

If you believe that this document breaches copyright please contact us providing details, and we will remove access to the work immediately and investigate your claim.

## Microbial water quality in clean water tanks following inspection and cleaning


Sarah C.B. Christensen, DTU Environment, Technical University of Denmark, Anne Esbjørn, VCS Denmark, Hans-Jørgen Albrechtsen, DTU Environment, Technical University of Denmark  
Contact info: Anne Esbjørn, [aes@vandcenter.dk](mailto:aes@vandcenter.dk), phone: +45 40808458, Sarah C.B. Christensen, [scch@env.dtu.dk](mailto:scch@env.dtu.dk), phone: +45 45251691

**Background:** After inspection and cleaning of clean water tanks, bacterial counts often increase for a period of days when the tanks are started up. The cause of the increased bacterial numbers is not known, therefore the water utility, VCS Denmark, and DTU Environment have conducted a joint project to investigate microbial growth in two clean water tanks at the main water work in Odense, Denmark. It is the desire of VCS Denmark to be able to distribute the drinking water to consumers immediately after the tanks have been cleaned by flushing with clean water at a medium pressure and without the use of chlorine or hydrogen peroxide and without preceding discard of large volumes of drinking water. The drinking water is ground water based and there is no physical biological barrier such as UV-filter or supplying of chlorine at the outlet of the clean water tanks.

**Aim:** The project aims to investigate why increased bacterial counts are often registered after start-up of clean water tanks despite the fact that VCS Denmark follows strict hygienic procedures. Since increased bacterial counts are often an indication of contamination or bacterial regrowth in drinking water systems the aim was to investigate whether the increased bacterial counts are due to intruding bacteria from the external environment or due to naturally present drinking water bacteria, not constituting a health risk. DNA analyses were applied to investigate the population dynamics in the system, including sand filters, sediment and water leaving the sand filters and clean water tanks. A best practice procedure for inspection, cleaning and following start-up will be developed based on the results.

Sampling campaigns were carried out in two clean water tanks to investigate growth before, during and after cleaning of the tanks. Growth potential, bacterial concentrations and dominating bacterial groups were quantified.

**Results:** Bacterial counts [yeast extract agar, 22°C] did not exceed guideline values at any point during the investigations. Immediately after start-up, a maximum of 10 CFU/ml (Colony Forming Units) were measured in both tanks and after less than 24 hours the concentrations were below 1 CFU/ml in both tanks. The low concentrations were maintained the following days. Bacterial counts [yeast extract agar, 37°C] were below 2 CFU/ml at all times. To include bacteria not normally quantified by traditional methods, such as plating, we included ATP (Adenosin-Tri-Phosphate) measurements of the water. ATP is an energy storage molecule present in all living bacteria.

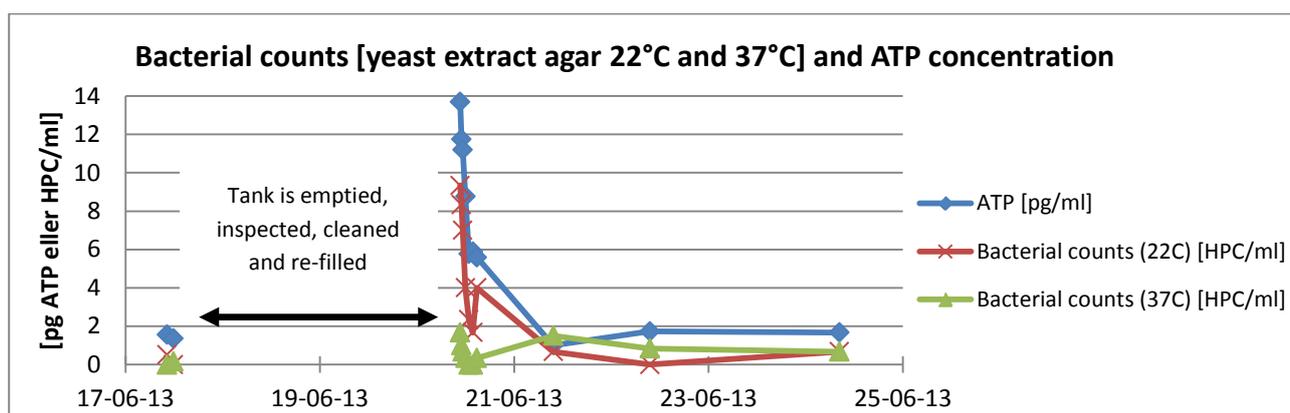

Concentration of ATP and bacterial counts [yeast extract agar, 22 and 37°C] in water leaving clean water tank 2 from the main water work at VCS Denmark.

ATP concentrations in the water immediately after start-up were high compared to the concentration of culturable bacteria which may indicate that the bacteria from the sand filter e.g. nitrifying bacteria, which normally grow on substrates not present in the agar, are present in the water. Results from DNA analyses are currently being analysed in order to verify whether the bacteria present in the water after start-up are typical sand filter or groundwater bacteria or there could be an external source for the bacteria.